



VTB Click Flooring January 1, 2019

Optional Polishing guide for VTB Click Flooring.

START WITH A CLEAN FLOOR:

1. Sweep and/or dust mop the floor to remove all dirt or grit.
2. Thoroughly clean the floor using Johnson Wax Professional G.P. Forward Cleaner. Dilute cleaner according to label directions. Use a green pad on an autoscrubber or 175 rpm machine.

NEVER USE A BLACK PAD ON VTB CLICK FLOOR.

3. Pick up the cleaner solution with a wet dry vac or auto scrubber.
4. Rinse floor thoroughly.
5. Allow floor to dry.
6. Apply 2 coats of Johnson Wax Professional Over and Under Sealer.
7. Allow 10-15 minutes after the sealer is dry to the touch before apply the next coat of product.
8. Apply 2-3 coats of Johnson Wax Professional Carefree Matte Floor Finish (low gloss), or for a higher gloss, apply 2-3 coats of Johnson Wax Professional Vectra or Carefree Floor Finish. Apply no more than three (3) coats in a 24-hour period. Allow 10-15 minutes after the finish is dry to the touch before applying the next coat.

NOTE: Since Over & Under is used as a base coat, other JohnsonDiversey floor finishes may also be used to meet a variety of gloss expectations and maintenance frequencies.

DAILY REGULAR MAINTENANCE

1. Sweep and/or dust mop the floor daily to remove surface dirt.
2. Damp mop or auto scrub using Johnson Wax Professional **Stride Neutral Cleaner** according to label instructions. Use a red pad on an autoscrubber or 175 rpm machine.
3. As needed, recoat or strip the floor when necessary.
4. Do not buff or burnish **Carefree Matte**, as this will increase the gloss level. **Vectra** or **Carefree** may be spray-buffed, using **Snapback Spray Buff** solution up to 1500 r.p.m.'s using ETC Aqua Plus burnishing pad or other appropriate pad.

RECOAT PROCEDURE

It may be necessary periodically to reapply floor polish to a heavily used floor.

1. Sweep and/or dust mop floor to remove surface dirt.
2. Thoroughly clean using Johnson Wax Professional with **GP Forward Cleaner** and a blue scrubbing pad.
3. **NEVER USE A BLACK STRIPPING PAD ON VTB Click Flooring!**
4. Rinse floor well and allow to dry.
5. Apply 2 coats of **Carefree Matte, Vectra or Carefree** Floor Finish.

STRIPPING PROCEDURE

1. Remove surface dirt.
2. Dilute Johnson Wax Professional **Bravo 1500+** or (**Pro Strip** for high speed programs) at 1:4 dilution. Use one gallon of stripper to four gallons of water.
3. Apply liberally to floor.
4. Let soak for 5-7 minutes, keeping uniformly wet.
5. Scrub with green scrubbing pad.
6. Pick up the cleaner solution with a wet dry vac or auto scrubber.
7. Rinse floor thoroughly.
8. Allow floor to dry.
9. Apply 2 coats of Johnson Wax Professional **Over and Under Sealer**.
10. Allow 10-15 minutes after the sealer is dry to the touch before apply the next coat of product.
11. Apply 2-3 coats of Johnson Wax Professional **Carefree Matte** Floor Finish or 2-3 coats of Johnson Wax Professional **Vectra** or **Carefree** Floor Finish. Apply no more than three (3) coats in a 24-hour period. Allow 10-15 minutes after the finish is dry to the touch before applying the next coat.

FOR MORE INFORMATION PLEASE CONTACT:

JOHNSON WAX PROFESSIONAL TECHNICAL SUPPORT: 1-800-558-2332

Stain removal

Stains should be removed immediately. Some stains may otherwise migrate into the PVC wear layer and will then be impossible to remove. This includes stains caused by asphalt, crayons, photocopier toner, rubber heel marks, ballpoint pen ink and shoe polish. The dyes used in certain plastic mats, rubber feet on domestic appliances, trolley wheels, print on plastic bags, etc, may also cause staining which cannot be removed.